

Property Inspection Report




123 ABC Dr. San Diego, CA 92067



Table of Contents

Definitions	2
General Information	2
Lots and Grounds	3
Exterior Surface and Components	3
Roof	5
Garage	6
Plumbing	7
Electrical	9
Laundry Room/Area	10
Attic	11
Structure	12
Fireplace	12
Air Conditioning	13
Heating System	15
Bathrooms	16
Bedrooms	18
Living Space	19
Kitchen	19
Inspection Agreement	22
Summary	30

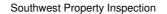



Definitions

NOTE: All definitions listed below refer to the property or item listed as inspected on this report at the time of inspection.

- A Acceptable Functional with no obvious signs of defect.
- NI Not inspected Item was unable to be inspected for safety reasons or due to lack of power, inaccessible, or disconnected at time of inspection.
- M Maintenance Item is not fully functional and requires repair or servicing.

HS Health & Safety Item needs immediate repair or replacement. It is a health and/or safety concern to the occupants.

General Information

Property Information

Property Address 123 ABC Dr. City San Diego State CA Zip 92067

Client Information


Client Name Bob & Joanne Smith

Inspection Company

Inspector Name Steve Lindsey Company Name Southwest Property Inspection Phone 866-302-2387 E-Mail steve@southwestinspect.com

Conditions

Others Present: Buyer, Buyer's agent Property Occupied? No Inspection Date 11/25/2013 Start Time: 10:00 End Time: 1:00 Electric On • Yes O No O Not Applicable Gas/Oil On • Yes O No O Not Applicable Water On • Yes O No O Not Applicable Temperature 75 Weather: Sunny Soil Conditions: Dry Space Below Grade None Building Type: Single family home- Two story Garage: Attached Year Built 1991 Approx. Square Feet 2405

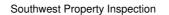




Lots and Grounds

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS

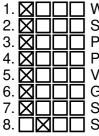

Walks: Concrete

- Steps/Stoops: Composite material
- Patio: Concrete
- Porch: Concrete
 - Vegetation: Trees, Shrubs
- Grading: Level
 - Swale: Adequate slope and depth for drainage
 - Surface Drains: Note: The outside area drains were not tested for functional drainage. Beyond the scope of this inspection. A qualified licensed drain specialist should be consulted, prior to close of escrow, to evaluate the system.
- 9. Oncrete
- 10. Hences: Wood
 - Lawn Sprinklers: Note: The landscaping irrigation system was not tested or evaluated. Beyond the scope of this inspection. A qualified licensed landscaping contractor should be consulted if an evaluation of the irrigation system is desired.

Exterior Surface and Components

Note: Regarding the weather protection at windows, doors, and sliding glass door units, it is not uncommon for moisture infiltration to occur into the building's interior during rainy weather regardless of the age of the property-This inspection was conducted by visual means only and the current condition and/or appropriate installation of concealed moisture barriers/flashings at exterior siding, doors, windows, balconies, decks, walks, stairs, driveways, exterior components or penetrations cannot be confirmed- Please refer to items 12 and 13 in Part III under Limitations, Exceptions and Exclusions of the CREIA Standards of Practice.

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS

Exterior Surface -

1. 🛛 🗌	Type: Stucco	Check cracking present.
2.	Fascia: Wood	Refer to the pest control report.
3. 🛛 🗌	Eaves: Wood	Refer to the pest control report.



Exterior Surface and Components (Continued)

4. Door Bell: The doorbell is inoperative. Repairs by a qualified licensed contractor are recommended.



5. **X**

Entry Door: Wood

Patio Doors: Vinyl slider with dual-pane glass The patio screen doors are missing. Recommend replacement. Repairs by a qualified licensed contractor are recommended.



7. Windows: Moisture and fogging were noted in the dual-pane glass of the windows in the following locations: 2nd floor master, 2nd floor guest bedroom and over open area above (Defective hermetic seals.) Repairs by a qualified licensed window contractor are recommended. Note: Due to climatic conditions, the nature of the components, and the cleanliness of the glass, it is not possible to determine all of the failures present. Evaluation of the remaining windows in the

not possible to determine all of the failures present. Evaluation of the remaining windows in the home by a qualified licensed glazing contractor is recommended prior to removal of purchase contingencies.



Page 4 of 33

Exterior Surface and Components (Continued)

Windows: (continued)



Window/Door Screens:

Exterior Lighting: Loose wiring and bulb assembly side of garage. Repairs by a qualified licensed electrician are recommended.



10.	\boxtimes		
11.	\boxtimes		
10			

Exterior Electric Outlets: 110 VAC GFCI

11. Hose Bibs:
 12. Gas Meter: Accessible Note: The gas meter is located at the side of the garage. Installation of an emergency shut-off wrench is recommended - None present.

Roof


9

Note: This roof inspection reports on the type and condition of the roofing materials, missing and/or damaged materials, and attachments (excluding solar systems, antennas, etc.) where visible. This does not constitute a warranty, guarantee, roof certification, or life expectancy evaluation of any kind. Roofs are not water tested for leaks. The condition of the roofing underlayment material was not verified/inspected. For further evaluation and a roof certification, we recommend you consult a qualified licensed roofing contractor. Buildings that have tile or wood shingle/shake materials and are going to be tented for termites should be reinspected for possible damage caused by the extermination process before the close of escrow.

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS

 Page 5 of 33

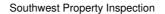



Roof (Continued)

2. Unable to Inspect: 75% Note: The 2nd story roof was inaccessible due to its height. A limited visual inspection was done from the ground using binoculars. Unseen defects may exist. A qualified licensed roofing contractor should be consulted for a complete evaluation.



- 3. Material: Concrete tile- Flat profile
- 4. Type: Gable roof
- 5. Flashing: Galvanized steel
- 6. 🛛
- U Valleys: Main Chimney -
- 7. 🛛 Chimney: Stucco and frame covered three-wall pipe
- Flue/Flue Cap: Metal w/spark arrestor 8. 🛛
- Chimney Flashing: Galvanized steel 9. 🛛
- 10. X Plumbing Vents: ABS

Garage

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS

Garage -

- 1. Type of Structure: Attached Car Spaces: 2
- 2. A Garage Doors: Metal- sectional roll-up
- Door Operation: Mechanized 3.
 - Door Opener: Lift Master The pressure sensor safety reversing system on the garage door opener requires adjustment. The door does not reverse when an object blocks its path- Safety hazard. Repairs by a qualified licensed garage door contractor are recommended.



Property Inspections Li

Garage (Continued)

5. **Fire Door: Fire-rated, Self-closing Closing mechanism** inoperative on the garage fire door (leading into the house) causing a breach in the fire-resistant-rated assembly between the garage and the house- Fire hazard. Repairs by a gualified licensed contractor are recommended.

Side Door: Metal 6. 🖂 7. 🖂 Walls:

8.

Ceiling: Drywall There are unrepaired holes in the garage ceiling causing a breach in the fire-resistant-rated assembly between the garage and the house- Fire hazard. There is an unrepaired hole in the garage ceiling causing a breach in the fire-resistant-rated assembly between the garage and the house- Fire hazard.

Floor/Foundation: Concrete slab 9. 🖂 Electrical: 110 VAC GFCI outlets, Lighting Wiring for front 10. $\Box \Gamma$ lights run off of light switch, recommend add separate junction box, Evaluation by a qualified licensed electrician is recommended.

Plumbing

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety


A NI MHS

1. Water Service Line: Underground







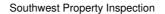



Plumbing (Continued)

- 2. Main Water Shutoff: Garage Note: Shut-off valves were not tested. Beyond the scope of this inspection.
- 3. Water Pressure: 100 PSI The water pressure is excessive. Excessive water pressure can cause damage and leaks at the plumbing components. Recommend having a qualified licensed plumber reduce the water pressure to 40 - 80 PSI.



- 4. Water Lines: Copper
- 5. Drain Pipes: ABS
- 6. Service Caps: Accessible
 - Vent Pipes: ABS
 - Gas Service Lines: Steel Note: A sediment trap is not installed on the gas supply lines for the water heater and furnace. This may void the manufacturer's warranty on the appliances and may cause damage or malfunction of the units. Refer to the manufacturer's installation instructions and to the local authority having jurisdiction as to whether or not one is required.

Garage Water Heater

7.


13.

8. 🖂

- 9.
- 10. Type: Natural gas- FVIR Capacity: 50 Gallon
- 11. X Seismic Strapping: Installed
- 12. Vent Pipe: B-vent

TPR Valve/Discharge Line: The TPR valve does not have a discharge line installed- Safety hazard. Repairs by a qualified licensed plumber are recommended.



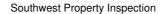




Electrical

Note: The electrical service panel is located at the exterior garage wall.

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS

- 1. Service Size Amps: 200 Volts: 120/240 VAC
- 2. Service: Underground
- 3. 2 110 VAC Branch Circuits: Copper
- 4. 220 VAC Branch Circuits: Copper
- 5. Conductor Type: Non-metallic sheathed cable
- 6. GFCI: Exterior, garage, kitchen, bathrooms
- 7. Grounding: Foundation steel
- 8. Bonding: Water piping
- 9. Smoke Detectors: Hallways, Bedrooms 10. CARbon Monoxide Detectors: There is n
 - Carbon Monoxide Detectors: There is not a carbon monoxide detector installed in the home. (Required outside of the sleeping areas in the immediate vicinity of the bedrooms, and on each level of the home.) Safety hazard to the occupants. Installation is advised in accordance with current applicable state and local regulations, and in the interest of occupant safety.
- 11. Security System: Note: The security system and its components were not inspected. Beyond the scope of this inspection.
- Electric Panel
- 12. Manufacturer: Cutler-Hammer The hinges are loose on the electric panel cover. The cover falls off. Water entry may occur. Fire/Shock hazard. Repairs by a qualified licensed electrician are recommended.

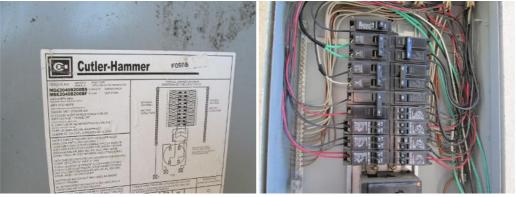





Manufacturer: (continued)



13. Max Capacity: 225 Amp

- 14. XIII Main Breaker Size: 200 Amp
- 15. Dereakers: Identified
- 16. Is the panel bonded? Yes O No

aundry Room/Area.

Note: The laundry connections were inspected by visual means only. The water supply and waste line piping that is concealed within inaccessible areas such as covered walls and concrete slab floors was not evaluated. The washing machine, clothes dryer, and any laundry equipment was not operated or evaluated as part of this inspection. It is advised to consult with the current owner to confirm there are no current or previous problems with the laundry supply and waste piping before the close of escrow.

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS

1st Floor Laundry Room/Area

- 1. 🖂 Ceiling: Drywall Walls: Drywall 2. 🛛
- 3. 🛛 Floor: Tile 4

5.

Electrical:

Washer Hose Bib: The hot and cold water valves are leaking. Repairs by a qualified licensed plumber are recommended.





Laundry Room/Area (Continued)

6. Dryer Vent: Metal duct

7. X Washer Drain: Standpipe

Attic

Note: The attic access is located in the 2nd floor hallway.

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS

Attic _____

4. 🛛

5. 🛛

6. XI

7. 🛛

- Method of Inspection: In the attic
 Mathematical Access: Wood door
- 3. X Roof Framing: Wood truss

Sheathing: O.S.B.

Insulation: Blown in, Fiberglass


Insulation Depth: Approx. 9 1/2

Ventilation: Gable and eave vents





8. Wiring/Lighting: 110 VAC lighting circuit

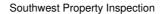



Structure

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS

- 1. Structure Type: Wood frame
- 2. Toundation: Concrete slab Not fully visible.
- 3. Bearing Walls: Wood frame
- 4. Floor Joists:
 - Floor/Slab: Not fully visible due to floor coverings.
 - Stairs/Handrails: Wood steps with wood handrails

Fireplace

5.

6.

Note: This inspection of the fireplace/chimney is limited to the readily visible portions. The inner reaches of a chimney flue are not visually accessible and the view from the top or bottom is not adequate to discover possible deficiencies or damage. A National Fire Protection Association (NFPA) 211 Standard, Level II inspection by a qualified professional, prior to removal of purchase contingencies, is recommended. Specialized tools, testing procedures, mirrors, and video cameras can be used by a qualified fireplace professional to thoroughly evaluate the fireplace system.

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS

Fireplace
1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

1.

2.

1.

2.

3.

2.

3.

3.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.

4.


4.

4.

4.



6. Hearth Extension: Tile

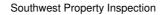



Air Conditioning

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS

1st Floor AC System -

- 1. A/C System: Functional
- 2. Condensate Removal: PVC
- 3. Condensing Unit:
- 4. Fuel Type: 220-240 VAC Temperature Differential: 18
- 5. Type: Central A/C Capacity:
- 6. Visible Coil: Copper core with aluminum fins
- 7. Refrigerant Lines: Serviceable condition
- 8. Electrical Disconnect: Tumble switch The dead-front cover is missing in the electrical disconnect box at the A/C condensing unit- Shock hazard. Recommend repairs by a qualified licensed contractor.



2nd Floor AC System -

9. A/C System Operation: Functional The A/C refrigerant line is crimped. Reduced system efficiency may occur. Repairs by a qualified licensed HVAC contractor are recommended.



Palm-Tech Inspector, Copyright © 1998-2022, PDmB, Inc.



Air Conditioning (Continued)

A/C System Operation: (continued)



- 10. Condensate Removal: PVC
- 11. Fuel Type: 220-240 VAC Temperature Differential: 17
- 12. Type: Central A/C Capacity:

15.


- 13. XIIII Visible Coil: Aluminum
- 14. 🛛 Refrigerant Lines: Serviceable condition

replacement of the filters.

Electrical Disconnect: Tumble switch The dead-front cover is missing in the electrical disconnect box at the A/C condensing unit- Shock hazard. Recommend repairs by a qualified licensed contractor.


size, The furnace air filter is dirty. Reduced efficiency and shortened life-span of the unit may occur. Recommend



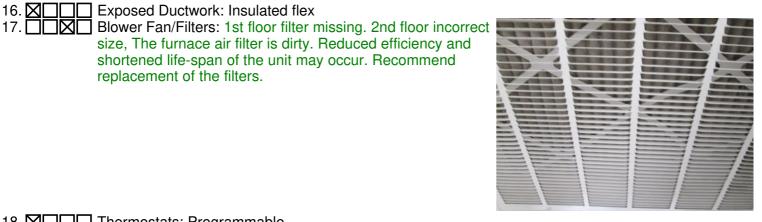

18. Thermostats: Programmable

Page 14 of 33

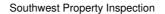



Heating System

Note: The furnaces are located in the attic.

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS

1st Floor Heating System -


1. Heating System: Inadequate The heating system is inoperative. Repairs by a qualified licensed HVAC contractor are recommended.



- 2. Manufacturer: York
- 3. Type: Forced air unit Capacity:
- 4. Fuel Type: Natural gas
- 5. Heat Exchanger:
- 6. Blower Fan/Filters:
- 7. 🖾 Distribution: Insulated flex
- 8. X Vent Pipe: B-vent
- Controls: 9. 🕅
- 2nd Floor Heating System -
- 10. Heating System Operation: Functional
- 11. Manufacturer: York



- 12. Area Served: 2nd floor only Approximate Age:
- 13. Fuel Type: Natural gas
- 14. Heat Exchanger: 15. Distribution: Fiberglass ducts 16. Exchanger: 15. Flue Pipe: B-vent
- 17. 🛛 Thermostats: Programmable

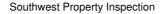





Bathrooms

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS


1st Floor Hallway Bathroom -

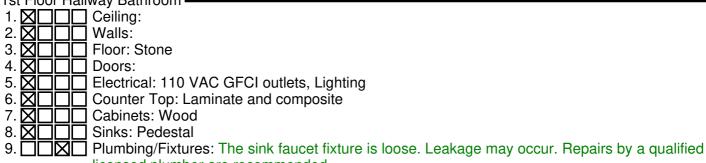

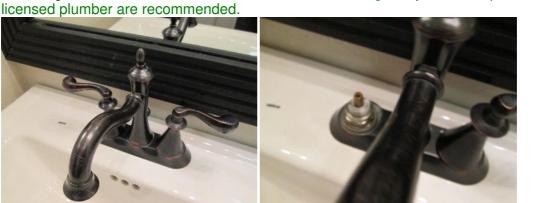

10. 🛛			Shower: Acrylic pan and surround
11. 🛛			Toilet:
12. 🛛			HVAC Source:
13. 🛛			Ventilation: Exhaust fan
2nd Fl	oor	Gι	lest Bathroom
14. 🛛			Ceiling:
15. 🛛			Walls:
16. 🛛			Floor: Vinyl
17. 🛛			Doors:
18. 🛛			Electrical: 110 VAC GFCI outlets, Lighting
19. 🛛			Counter Top: Tile
20. 🛛			Cabinets: Wood
21. 🛛			Sinks: Porcelain single-bowl
22. 🛛			Plumbing/Fixtures:
23. 🛛] Tub:
24. 🛛			Shower:

Page 16 of 33

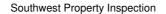

Property Inspections LL


Bathrooms (Continued)

25. Toilet: The toilet does not flush properly. The flush assembly requires repair or adjustment. Repairs by a qualified licensed plumber are recommended.



HVAC Source: 26. 🛛 27. Ventilation: Exhaust fan ٦Г Master Bathroom 28. **2** Ceiling: 29. 🛛 Walls: 30. 🛛 Floor: Carpet 31. 🕅 Doors:

32. Windows: The window latch by the toilet is damaged. Repairs by a qualified window contractor are recommended.

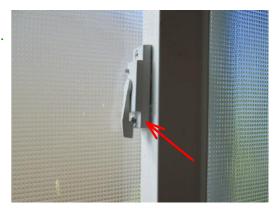

33. 2 Elec 34. 2 Cou 35. 2 Cab 36. 2 Sink 37. 2 Plun
--

al: 110 VAC GFCI outlets, Lighting r Top: ts: Wood

- Porcelain- Dual basin
- ng/Fixtures:

Page 17 of 33

Page 18 of 33



Bathrooms (Continued)

38. Tub: The caulking around the top of tub is deteriorated. Moisture penetration may occur. Repairs by a qualified licensed contractor are recommended.



Shower: Acrylic pan and ceramic tile s	surround
--	----------

- 40. **X**
- 41. HVAC Source:
- 42.

recommended.

Bedrooms

39.

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS

Be	edroom —	
		_

1.区		Clo
2. 🛛		Ce
3. 🛛		Wa
4. 🛛		Flc
5.	\square	l Do

Closets: Ceilings: Drywall Walls: Drywall Floors: Hardwood Doors: The door hardware is loose in the 2nd floor guest bedroom, Repairs by a qualified licensed contractor are



Page 19 of 33



Bedrooms (Continued)

6. Windows: The window glass is cracked in the 2nd floor front guest bedroom. Repairs by a qualified window contractor are recommended.





7. Electrical: 110 VAC outlets, Lighting 8. HVAC Source:

Living Space

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS

Living Space	
	Closets:
2.	Ceilings: Drywall
3.	Walls: Drywall
4.	Floors: Stone
5. 🛛 🗌 🗌 🗌	Doors:
6.	Windows: Vinyl with dual-pane glass
7.	Electrical: 110 VAC outlets, Lighting
8. 🛛 🗌 🗌	HVAC Source:

Kitchen

A = Acceptable, NI = Not Inspected, M = Maintenance, HS = Health & Safety

A NI MHS

1st Floor Kitchen



Kitchen (Continued)

1. Cooking Appliances: General Electric




2. Ventilator: A duct for the oven exhaust fan is not installed. The exhaust air blows into the upper cabinet. Repairs by a certified appliance technician are recommended.



3. Disposal: 4. Dishwasher: Amana



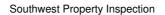



Kitchen (Continued)

5. Air Gap Present? • Yes O No Water flows out of the air gap and onto the countertop when the dishwasher drains. The knock-out at the food waste disposal may not be removed. Water damage may occur. Repairs by a qualified licensed plumber are recommended.



6.	\boxtimes		S
7.	\boxtimes		E
	\boxtimes		F
9.		\boxtimes	(

Sink: Stainless steel- Dual basin

Electrical: 110 VAC GFCI outlets, Lighting

Plumbing/Fixtures: Counter Top: Tile The grouting is cracked at the

countertop back-splash. Water entry may occur. Re-grouting by a qualified licensed contractor is recommended.




Cabinets: Wood 10. 🛛

- 11. Ceiling: Drywall 12. 🛛
 - Walls:
 - Floor: Stone Windows: Vinyl with dual-pane glass
- 14. 🕅 15. 🛛

13. 🛛

HVAC Source:

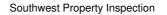



Inspection Agreement

Property Information

Client Information

Inspection Company

Inspector Name Steve Lindsey Company Name Southwest Property Inspection

Conditions

STANDARD RESIDENTIAL INSPECTION AGREEMENT

THIS IS INTENDED TO BE A LEGALLY BINDING CONTRACT, PLEASE READ IT CAREFULLY.

SCOPE OF THE INSPECTION: The real estate inspection to be performed for the Client is a survey and basic operation of the systems and components of a building which can be reached, entered, or viewed without difficulty, moving obstructions, or requiring any action which may result in damage to the property or personal injury to the Inspector. The purpose of the inspection is to provide the Client with information regarding the general condition of the building(s). Inspector will prepare and provide Client a written report for the sole use and benefit of Client. The written report shall document any material defects discovered in the building's systems and components which, in the opinion of the Inspector, are safety hazards, are not functioning properly, or appear to be at the ends of their service lives. The inspection shall be performed in accordance with the Standards of Practice of the California Real Estate Inspection Association (CREIA), attached hereto and incorporated herein by reference, and is limited to those items specified herein.

CLIENT'S DUTY: Client agrees to read the entire written report when it is received and promptly call Inspector with any questions or concerns regarding the inspection or the written report. The written report shall be the final and exclusive findings of Inspector. Client acknowledges that Inspector is a generalist and that further investigation of a reported condition by an appropriate specialist may provide additional information which can affect Client's purchase decision. Client agrees to obtain further evaluation of reported conditions before removing any investigation contingency and prior to the close of the transaction. In the event Client becomes aware of a reportable condition which was not reported by Inspector, Client agrees to promptly notify Inspector and allow Inspector andIor Inspector's designated representative(s) to inspect said condition(s) prior to making any repair, alteration, or replacement. Client agrees that any failure to so notify Inspector and allow inspection is a material breach of this Agreement.

ENVIRONMENTAL CONDITIONS: Client agrees what is being contracted for is a building inspection and not an environmental evaluation. The inspection is not intended to detect identify, or disclose any health or environmental conditions regarding this building or property, including, but not limited to: the presence of asbestos, radon, lead, urea-formaldehyde, fungi, molds, mildew, PCBs, or other toxic, reactive, combustible, or corrosive contaminants, materials, or substances in the water, air, soil, or building materials. The Inspector is not liable for injury, health risks, or damage caused or contributed to by these conditions.

GENERAL PROVISIONS: The written report is not a substitute for any transferor's or agent's disclosure that may be required by law, or a substitute for Client's independent duty to reasonably evaluate the property prior to the close of the transaction. This inspection Agreement, the real estate inspection, and the written report do not constitute a home warranty, guarantee, or insurance policy of any kind whatsoever. No legal action or proceeding



of any kind, including those sounding in tort or contract, can be commenced against Inspector/Inspection Company or its officers, agents, or employees more than one year from the date Client discovers, or through the exercise of reasonable diligence should have discovered, the cause of action. In no event shall the time for commencement of a legal action or proceeding exceed two years from the date of the subject inspection. THIS TIME PERIOD IS SHORTER THAN OTHERWISE PROVIDED BY LAW.

This Agreement shall be binding upon and inure to the benefit of the parties hereto and their heirs, successors, and assigns.

This Agreement constitutes the entire integrated agreement between the parties hereto pertaining to the subject matter hereof and may be modified only by a written agreement signed by all of the parties hereto. No oral agreements, understandings, or representations shall change, modify, or amend any part of this Agreement. Each party signing this Agreement warrants and represents that helshe has the full capacity and authority to execute this Agreement on behalf of the named party. If this Agreement is executed on behalf of Client by any third party, the person executing this Agreement expressly represents to Inspector that helshe has the full and complete authority to execute this Agreement on Client's behalf and to fully and completely bind Client to all of the terms, conditions, limitations, exceptions, and exclusions of this Agreement.

SEVERABILITY: Should any provision of this Agreement be held by a court of competent jurisdiction to be either invalid or unenforceable, the remaining provisions of this Agreement shall remain in full force and effect, unimpaired by the court's holding.

MEDIATION: The parties to this Agreement agree to attend, in good faith, mediation with a retired judge or lawyer with at least 5 years of mediation experience before any lawsuit is filed. All notices of mediation must be served in writing by return receipt requested allowing 30 days for response. If no response is forthcoming the moving party may then demand binding arbitration under the terms and provisions set forth below.

ARBITRATION: Any dispute concerning the interpretation or enforcement of this Agreement, the inspection, the inspection report or any other dispute arising out of this relationship, shall be resolved between the parties by binding arbitration conducted in accordance with California Law, except that the parties shall select an arbitrator who is familiar with the real estate profession. The parties agree that they shall be entitled to discovery procedures within the discretion of the arbitrator. The arbitrator shall manage and hear the case applying the laws of the State of California to all issues submitted in the arbitration proceeding. The award of the arbitrator shall be final, and a judgment may be entered on it by any court having jurisdiction. Any disputes are to be arbitrated by: Construction Arbitration Services, Inc.

RESIDENTIAL STANDARDS OF PRACTICE - FOUR OR FEWER UNITS

Part I. Definitions and Scope

These Standards of Practice provide guidelines for a real estate inspection and define certain terms relating to these inspections. Italicized words in these Standards are defined in Part IV, Glossary of Terms.

A. A real estate inspection is a survey and basic operation of the systems and components of a building which can be reached, entered, or viewed without difficulty, moving obstructions, or requiring any action which may result in damage to the property or personal injury to the Inspector. The purpose of the inspection is to provide the Client



Inspection Agreement (Continued)

with information regarding the general condition of the building(s). Cosmetic and aesthetic conditions shall not be considered.

B. A real estate inspection report provides written documentation of material defects discovered in the inspected building's systems and components which, in the opinion of the Inspector, are safety hazards, are not functioning properly, or appear to be at the ends of their service lives. The report may include the Inspector's recommendations for correction or further evaluation.

C. Inspections performed in accordance with these Standards of Practice are not technically exhaustive and shall apply to the primary building and its associated primary parking structure.

Part II. Standards of Practice

A real estate inspection includes the readily accessible systems and components or a representative number of multiple similar components listed in SECTIONS 1 through 9 subject to the limitations, exceptions, and exclusions in Part III.

SECTION 1 - Foundation, Basement, and Under-floor Areas

- A. Items to be inspected:
- 1. Foundation system
- 2. Floor framing system
- 3. Under-floor ventilation
- 4. Foundation anchoring and cripple wall bracing
- 5. Wood separation from soil
- 6. Insulation
- B. The Inspector is not required to:

1. Determine size, spacing, location, or adequacy of foundation bolting/bracing components or reinforcing systems

2. Determine the composition or energy rating of insulation materials

SECTION 2 - Exterior

- A. Items to be inspected:
- 1. Surface grade directly adjacent to the buildings
- 2. Doors and windows
- 3. Attached decks, porches, patios, balconies, stairways, and their enclosures
- 4. Wall cladding and trim
- 5. Portions of walkways and driveways that are adjacent to the buildings
- B. The Inspector is not required to:
- 1. Inspect door or window screens, shutters, awnings, or security bars
- 2. Inspect fences or gates or operate automated door or gate openers or their safety devices
- 3. Use a ladder to inspect systems or components

SECTION 3 - Roof Covering

- A. Items to be inspected:
- 1. Covering
- 2. Drainage



- 3. Flashings
- 4. Penetrations
- 5. Skylights
- B. The Inspector is not required to:
- 1. Walk on the roof surface if in the opinion of the Inspector there is risk of damage or a hazard to the Inspector
- 2. Warrant or certify that roof systems, coverings, or components are free from leakage

SECTION 4 - Attic Areas and Roof Framing

- A. Items to be inspected:
- 1. Framing
- 2. Ventilation
- 3. Insulation
- B. The Inspector is not required to:
- 1. Inspect mechanical attic ventilation systems or components
- 2. Determine the composition or energy rating of insulation materials

SECTION 5 - Plumbing

- A. Items to be inspected:
- 1. Water supply piping
- 2. Drain, waste, and vent piping
- 3. Faucets and fixtures
- 4. Fuel gas piping
- 5. Water heaters
- 6. Functional flow and functional drainage
- B. The Inspector is not required to:

1. Fill any fixture with water or inspect overflow drains or drain-stops, or evaluate backflow devices, waste ejectors, sump pumps, or drain line cleanouts

2. Inspect or evaluate water temperature balancing devices, temperature fluctuation, time to obtain hot water, water circulation, or solar heating systems or components

- 3. Inspect whirlpool baths, steam showers, or sauna systems or components
- 4. Inspect fuel tanks or determine if the fuel gas system is free of leaks
- 5. Inspect wells or water treatment systems

SECTION 6 - Electrical

- A. Items to be inspected:
- 1. Service equipment
- 2. Electrical panels
- 3. Circuit wiring
- 4. Switches, receptacles, outlets, and lighting fixtures
- B. The Inspector is not required to:
- 1. Operate circuit breakers or circuit interrupters
- 2. Remove cover plates
- 3. Inspect de-icing systems or components



4. Inspect private or emergency electrical supply systems or components

SECTION 7 - Heating and Cooling

- A. Items to be inspected:
- 1. Heating equipment
- 2. Central cooling equipment
- 3. Energy source and connections
- 4. Combustion air and exhaust vent systems
- 5. Condensate drainage
- 6. Conditioned air distribution systems

B. The Inspector is not required to:

- 1. Inspect heat exchangers or electric heating elements
- 2. Inspect non-central air conditioning units or evaporative coolers
- 3. Inspect radiant solar, hydronic, or geothermal systems or components
- 4. Determine volume, uniformity, temperature, airflow, balance, or leakage of any air distribution system
- 5. Inspect electronic air filtering or humidity control systems or components

SECTION 8 - Fireplaces and Chimneys

- A. Items to be inspected:
- 1. Chimney exterior
- 2. Spark arrestor
- 3. Firebox
- 4. Damper
- 5. Hearth extension
- B. The Inspector is not required to:
- 1. Inspect chimney interiors
- 2. Inspect fireplace inserts, seals, or gaskets
- 3. Operate any fireplace or determine if a fireplace can be safely used

SECTION 9 - Building Interior

- A. Items to be inspected:
- 1. Walls, ceilings, and floors
- 2. Doors and windows
- 3. Stairways, handrails, and guardrails
- 4. Permanently installed cabinets
- 5. Permanently installed cook-tops, mechanical range vents, ovens, dishwashers, and food waste disposers
- 6. Absence of smoke alarms
- 7. Vehicle doors and openers
- B. The Inspector is not required to:
- 1. Inspect window, door, or floor coverings
- 2. Determine whether a building is secure from unauthorized entry
- 3. Operate or test smoke alarms or vehicle door safety devices
- 4. Use a ladder to inspect systems or components

Page 26 of 33



Part III. Limitations, Exceptions, and Exclusions

A. The following are excluded from a real estate inspection:

1. Systems or components of a building, or portions thereof, which are not readily accessible, not permanently installed, or not inspected due to circumstances beyond the control of the Inspector or which the Client has agreed or specified are not to be inspected

2. Site improvements or amenities, including, but not limited to; accessory buildings, fences, planters, landscaping, irrigation, swimming pools, spas, ponds, waterfalls, fountains or their components or accessories

3. Auxiliary features of appliances beyond the appliance's basic function

4. Systems or components, or portions thereof, which are under ground, under water, or where the Inspector must come into contact with water

5. Common areas as defined in California Civil Code section 1351, et seq., and any dwelling unit systems or components located in common areas

6. Determining compliance with manufacturers' installation guidelines or specifications, building codes, accessibility standards, conservation or energy standards, regulations, ordinances, covenants, or other restrictions

7. Determining adequacy, efficiency, suitability, quality, age, or remaining life of any building, system, or component, or marketability or advisability of purchase

8. Structural, architectural, geological, environmental, hydrological, land surveying, or soils-related examinations
 9. Acoustical or other nuisance characteristics of any system or component of a building, complex, adjoining property, or neighborhood

10. Conditions related to animals, insects, or other organisms, including fungus and mold, and any hazardous, illegal, or controlled substance, or the damage or health risks arising there from

11. Risks associated with events or conditions of nature including, but not limited to; geological, seismic, wildfire, and flood

12. Water testing any building, system, or component or determine leakage in shower pans, pools, spas, or any body of water

13. Determining the integrity of hermetic seals at multi-pane glazing

14. Differentiating between original construction or subsequent additions or modifications

15. Reviewing information from any third-party, including but not limited to; product defects, recalls, or similar notices

16. Specifying repairs/replacement procedures or estimating cost to correct

17. Communication, computer, security, or low-voltage systems and remote, timer, sensor, or similarly controlled systems or components

18. Fire extinguishing and suppression systems and components or determining fire resistive qualities of materials or assemblies

19. Elevators, lifts, and dumbwaiters

20. Lighting pilot lights or activating or operating any system, component, or appliance that is shut down, unsafe to operate, or does not respond to normal user controls

21. Operating shutoff valves or shutting down any system or component

22. Dismantling any system, structure, or component or removing access panels other than those provided for homeowner maintenance

B. The Inspector may, at his or her discretion:

 Inspect any building, system, component, appliance, or improvement not included or otherwise excluded by these Standards of Practice. Any such inspection shall comply with all other provisions of these Standards.
 Include photographs in the written report or take photographs for Inspector's reference without inclusion in the written report. Photographs may not be used in lieu of written documentation.




Part IV. Glossary of Terms

*NOTE: All definitions apply to derivatives of these terms when italicized in the text.

Appliance: An item such as an oven, dishwasher, heater, etc. which performs a specific function Building: The subject of the inspection and its primary parking structure Component: A part of a system, appliance, fixture, or device Condition: Conspicuous state of being Determine: Arrive at an opinion or conclusion pursuant to a real estate inspection Device: A component designed to perform a particular task or function Fixture: A plumbing or electrical component with a fixed position and function Function: The normal and characteristic purpose or action of a system, component, or device Functional Drainage: The ability to empty a plumbing fixture in a reasonable time Functional Flow: The flow of the water supply at the highest and farthest fixture from the building supply shutoff valve when another fixture is used simultaneously Inspect: Refer to Part I, "Definition and Scope", Paragraph A Inspector: One who performs a real estate inspection Normal User Control: Switch or other device that activates a system or component and is provided for use by an occupant of a building Operate: Cause a system, appliance, fixture, or device to function using normal user controls Permanently Installed: Fixed in place, e.g. screwed, bolted, nailed, or glued Primary Building: A building that an Inspector has agreed to inspect Primary Parking Structure: A building for the purpose of vehicle storage associated with the primary building Readily Accessible: Can be reached, entered, or viewed without difficulty, moving obstructions, or requiring any action which may harm persons or property Real Estate Inspection: Refer to Part I, "Definitions and Scope", Paragraph A Representative Number: Example, an average of one component per area for multiple similar components such as windows, doors, and electrical outlets Safety Hazard: A condition that could result in significant physical injury Shut Down: Disconnected or turned off in a way so as not to respond to normal user controls System: An assemblage of various components designed to function as a whole Technically Exhaustive: Examination beyond the scope of a real estate inspection, which may require disassembly, specialized knowledge, special equipment, measuring, calculating, quantifying, testing, exploratory probing, research, or analysis NOTE: Southwest Property Inspections has affiliations with third-party service providers (TPSP) in order to offer value-added services to our Clients. The company may arrange for these TPSPs to send literature or make post-inspection contact with our clients. ESCROW BILLING: An additional fee of \$100.00 will be incurred for those clients billing through escrow. If escrow

REPORT DELIVERY: The inspection report will be delivered to all real estate agents involved in the transaction unless you request us not to.

is cancelled for any reason, your credit card will be billed for the entire inspection fee.

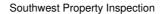



Final Comments

REGARDING REPAIRS: It is recommended that any deficiencies and the components/systems related to these deficiencies noted in the report be evaluated/inspected and repaired as needed by licensed contractors/professionals PRIOR TO THE CLOSE OF ESCROW. Further evaluation PRIOR to the close of escrow is recommended so a properly licensed professional can further evaluate our concerns and inspect the remainder of the system or component for additional concerns that may be outside our area of expertise or the scope of this inspection.


PHOTOS: The photos shown in this report are representative. There may not be photos of all deficient items present. A qualified licensed professional should be consulted to determine the full extent of repairs necessary for each deficient item noted.

WATER/MOISTURE: Water leaks, water intrusion, and moisture can cause mold and mildew. If such conditions were noted in this report, further investigation by a certified microbial consultant or a licensed industrial hygienist is recommended.

NOTICE TO THIRD PARTIES: This inspection report is for the sole benefit and reliance of the Client named in the original report and is not transferable to any third party. The report of the inspection and all consultation between the Inspector and the Client is issued subject to the terms, conditions, and limitations under which the inspection was performed. The terms, conditions, and limitations are a part of this report and are attached hereto and incorporated herein by reference. The Inspector assumes no liability for third party intervention, reliance, or use of this report prepared for the Client named herein. THIRD PARTIES ARE ENCOURAGED TO OBTAIN A HOME INSPECTION FROM A QUALIFIED INSPECTOR OF THEIR CHOICE. ANY THIRD PARTY, INCLUDING OTHER PURCHASERS WHO ARE NOT PART OF THIS CONTRACT, MAY NOT RELY ON, OR USE, THIS REPORT FOR ANY PURPOSE AND SHOULD NOT MAKE ANY DECISIONS BASED ON THIS REPORT. THE INSPECTOR ASSUMES NO LIABILITY FOR THIRD PARTY INTERPRETATION OR USE OF THIS REPORT.

HAZARDOUS MATERIAL WARNING: Lead, asbestos, radon, and other environmental hazards, materials, or conditions are beyond the scope of this property inspection and are specifically excluded. Asbestos was widely used in building materials prior to 1978, with limited use thereafter. Paint manufactured prior to 1978 commonly contained lead. Your real estate agent may be able to provide you with information regarding these, and other, hazardous materials that may be present. An environmental survey may be obtained by contracting with an appropriate specialist.

CHINESE DRYWALL: The Inspector is not qualified to detect the presence of Chinese drywall. Accordingly, the issue of Chinese drywall (and its potential problems) is beyond the scope of this inspection.

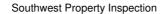



Maintenance Summary

IMPORTANT NOTE- PLEASE READ: This summary provides a brief overview of the report. It is not all-encompassing. Reading this summary is not a substitute for reading the report in its entirety. The entire inspection report must be read to fully assess the findings of the inspection. This list is not intended to determine which items may need to be addressed per the contractual requirements of the sale of the property. Any areas of uncertainty regarding the contract should be clarified by consulting an attorney or real estate agent.

It is recommended that any deficiencies and the components/systems related to these deficiencies noted in the report be evaluated/inspected and repaired as needed by licensed contractors/professionals PRIOR TO THE CLOSE OF ESCROW. Further evaluation PRIOR to the close of escrow is recommended so a properly licensed professional can further evaluate our concerns and inspect the remainder of the system or component for additional concerns that may be outside our area of expertise or the scope of this inspection.

Exterior Surface and Components

- 1. Door Bell: The doorbell is inoperative. Repairs by a qualified licensed contractor are recommended.
- 2. Patio Doors: Vinyl slider with dual-pane glass The patio screen doors are missing. Recommend replacement. Repairs by a qualified licensed contractor are recommended.
- Windows: Moisture and fogging were noted in the dual-pane glass of the windows in the following locations: 2nd floor master, 2nd floor guest bedroom and over open area above (Defective hermetic seals.) Repairs by a qualified licensed window contractor are recommended. Note: Due to climatic conditions, the nature of the components, and the cleanliness of the glass, it is not possible to determine all of the failures present. Evaluation of the remaining windows in the home by a qualified licensed glazing contractor is recommended prior to removal of purchase contingencies.
 Exterior Lighting: Loose wiring and bulb assembly side of garage. Repairs by a gualified licensed electrician are
- 4. Exterior Lighting: Loose wiring and bulb assembly side of garage. Repairs by a qualified licensed electrician are recommended.

<u>Garage</u>

5. Garage Electrical: 110 VAC GFCI outlets, Lighting Wiring for front lights run off of light switch, recommended add separate junction box, Evaluation by a qualified licensed electrician is recommended.

Plumbing

6. Water Pressure: 100 PSI The water pressure is excessive. Excessive water pressure can cause damage and leaks at the plumbing components. Recommend having a qualified licensed plumber reduce the water pressure to 40 - 80 PSI.

Laundry Room/Area

7. 1st Floor Laundry Room/Area Washer Hose Bib: The hot and cold water valves are leaking. Repairs by a qualified licensed plumber are recommended.

Air Conditioning

- 8. 2nd Floor AC System A/C System Operation: Functional The A/C refrigerant line is crimped. Reduced system efficiency may occur. Repairs by a qualified licensed HVAC contractor are recommended.
- Blower Fan/Filters: 1st floor filter missing. 2nd floor incorrect size, The furnace air filter is dirty. Reduced efficiency and shortened life-span of the unit may occur. Recommend replacement of the filters. Heating System
- 10. 1st Floor Heating System Heating System: Inadequate The heating system is inoperative. Repairs by a qualified licensed HVAC contractor are recommended.



Maintenance Summary (Continued)

Bathrooms


- 11. 1st Floor Hallway Bathroom Plumbing/Fixtures: The sink faucet fixture is loose. Leakage may occur. Repairs by a qualified licensed plumber are recommended.
- 12. 2nd Floor Guest Bathroom Toilet: The toilet does not flush properly. The flush assembly requires repair or adjustment. Repairs by a qualified licensed plumber are recommended.
- 13. Master Bathroom Windows: The window latch by the toilet is damaged. Repairs by a qualified window contractor are recommended.
- 14. Master Bathroom Tub: The caulking around the top of tub is deteriorated. Moisture penetration may occur. Repairs by a qualified licensed contractor are recommended.

Bedrooms

- 15. Bedroom Doors: The door hardware is loose in the 2nd floor guest bedroom, Repairs by a qualified licensed contractor are recommended.
- 16. Bedroom Windows: The window glass is cracked in the 2nd floor front guest bedroom. Repairs by a qualified window contractor are recommended.

Kitchen

- 17. 1st Floor Kitchen Ventilator: A duct for the oven exhaust fan is not installed. The exhaust air blows into the upper cabinet. Repairs by a certified appliance technician are recommended.
- 18. 1st Floor Kitchen Air Gap Present? Yes Water flows out of the air gap and onto the countertop when the dishwasher drains. The knock-out at the food waste disposal may not be removed. Water damage may occur. Repairs by a qualified licensed plumber are recommended.
- 19. 1st Floor Kitchen Counter Top: Tile The grouting is cracked at the countertop back-splash. Water entry may occur. Re-grouting by a qualified licensed contractor is recommended.

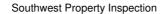



Health & Safety Summary

IMPORTANT NOTE- PLEASE READ: This summary provides a brief overview of the report. It is not all-encompassing. Reading this summary is not a substitute for reading the report in its entirety. The entire inspection report must be read to fully asses the findings of the inspection. This list is not intended to determine which items may need to be addressed per the contractual requirements of the sale of the property. Any areas of uncertainty regarding the contract should be clarified by consulting an attorney or real estate agent.

It is recommended that any deficiencies and the components/systems related to these deficiencies noted in the report be evaluated/inspected and repaired as needed by licensed contractors/professionals PRIOR TO THE CLOSE OF ESCROW. Further evaluation PRIOR to the close of escrow is recommended so a properly licensed professional can further evaluate our concerns and inspect the remainder of the system or component for additional concerns that may be outside our area of expertise or the scope of this inspection.

Garage

- 1. Garage Door Opener: Lift Master The pressure sensor safety reversing system on the garage door opener requires adjustment. The door does not reverse when an object blocks its path- Safety hazard. Repairs by a qualified licensed garage door contractor are recommended.
- 2. Garage Fire Door: Fire-rated, Self-closing Closing mechanism inoperative on the garage fire door (leading into the house) causing a breach in the fire-resistant-rated assembly between the garage and the house- Fire hazard. Repairs by a qualified licensed contractor are recommended.
- 3. Garage Ceiling: Drywall There are unrepaired holes in the garage ceiling causing a breach in the fire-resistant-rated assembly between the garage and the house- Fire hazard. There is an unrepaired hole in the garage ceiling causing a breach in the fire-resistant-rated assembly between the garage and the house-Fire hazard.

Plumbing

4. Garage Water Heater TPR Valve/Discharge Line: The TPR valve does not have a discharge line installed-Safety hazard. Repairs by a qualified licensed plumber are recommended.

Electrical

- 5. Carbon Monoxide Detectors: There is not a carbon monoxide detector installed in the home. (Required outside of the sleeping areas in the immediate vicinity of the bedrooms, and on each level of the home.) Safety hazard to the occupants. Installation is advised in accordance with current applicable state and local regulations, and in the interest of occupant safety.
- 6. Electric Panel Manufacturer: Cutler-Hammer The hinges are loose on the electric panel cover. The cover falls off. Water entry may occur. Fire/Shock hazard. Repairs by a qualified licensed electrician are recommended.

Fireplace

7. Fireplace Damper: Metal A damper clamp is not installed in the fireplace- Safety hazard. The damper is required to be permanently blocked open in fireplaces containing a gas fixture to prevent gas leaks from entering the home. Installation by a qualified licensed contractor is advised.

Air Conditioning

- 8. 1st Floor AC System Electrical Disconnect: Tumble switch The dead-front cover is missing in the electrical disconnect box at the A/C condensing unit- Shock hazard. Recommend repairs by a qualified licensed contractor.
- 2nd Floor AC System Electrical Disconnect: Tumble switch The dead-front cover is missing in the electrical disconnect box at the A/C condensing unit- Shock hazard. Recommend repairs by a qualified licensed contractor.



Health & Safety Summary (Continued)